Tracker installation

Glass stillages come in a variety of shapes and sizes. This manual contains the general guidelines for the installation of trackers on glass stillages. We use a fairly generic stillage form factor for this.

Make sure the tracker is not fully surrounded by metal parts, as this blocks the signal.



Protect the tracker by using the cooler unit's shape if possible.

Place the tracker as high as possible on the asset.

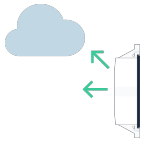

Ensure the tracker has a clear view of the sky.

Do's	Don'ts
Install the tracker as high as possible	On moving parts (lids, doors)
Vertical installation if possible	Close to forklift pick up holes
Clear view on the sky	Under the stillage (bad signal)
Use asset's cavaties to install the tracker	On the very outside where the tracker might get hit by other equipment
Install between metal ribs	

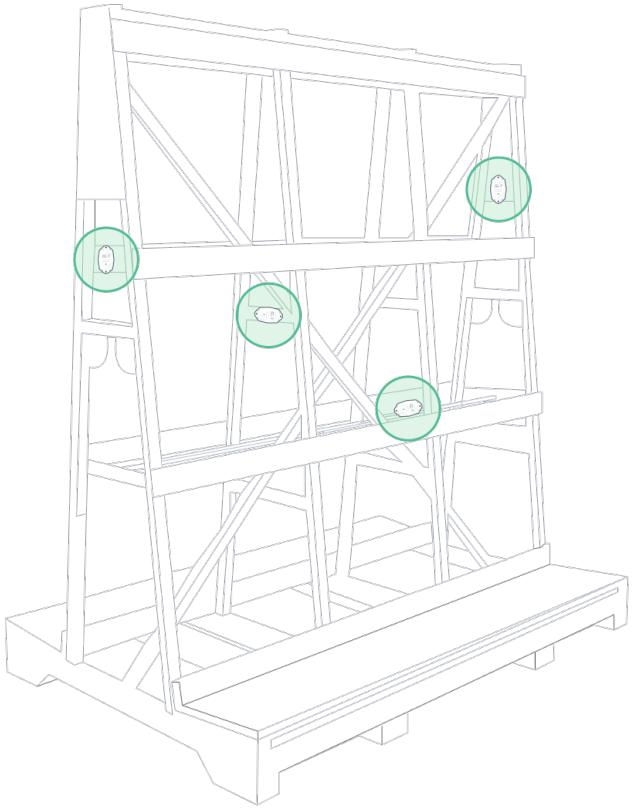

Safety advice – device subjected to strong mechanical impact

Risk of delayed battery failure and chemical hazard

If a device has been hit, crushed, or struck by a heavy object (for example a forklift, container, pallet, or falling load), the internal components and battery may be damaged even if no external damage is visible. Such damage can result in delayed overheating, leakage, or failure.

If a device has been subjected to a strong mechanical impact, the following mandatory safety actions must be taken:

#	Action	Details
1	Do not touch the device	Do not move, lift, open, shake, or inspect the device immediately after the impact. Internal damage may cause delayed reactions.
2	Keep a minimum safety distance	Maintain a clear distance of at least 5 meters from the device. Keep all personnel away during this period.
3	Wait at least 10 minutes	The device must remain untouched and undisturbed for a minimum of 10 minutes following the impact. This waiting time allows potential delayed thermal or chemical reactions to become evident.
4	Observe from a safe distance	Watch for warning signs: smoke, vapor, or unusual odor; heat generation; fluid leakage; hissing, cracking, or popping noises.
5	After the waiting period	If any abnormal condition is observed, isolate the area immediately and notify responsible safety or supervisory personnel. The device must be quarantined and handled according to battery safety and disposal procedures. The device must not be used.

A device may appear undamaged and still be unsafe. Normal operation after impact does NOT mean the device is safe. Failure to follow this safety advice may result in serious injury, fire, or chemical exposure.